


CIRCUIT DRAWN WITH POWER SUPPLY OFF

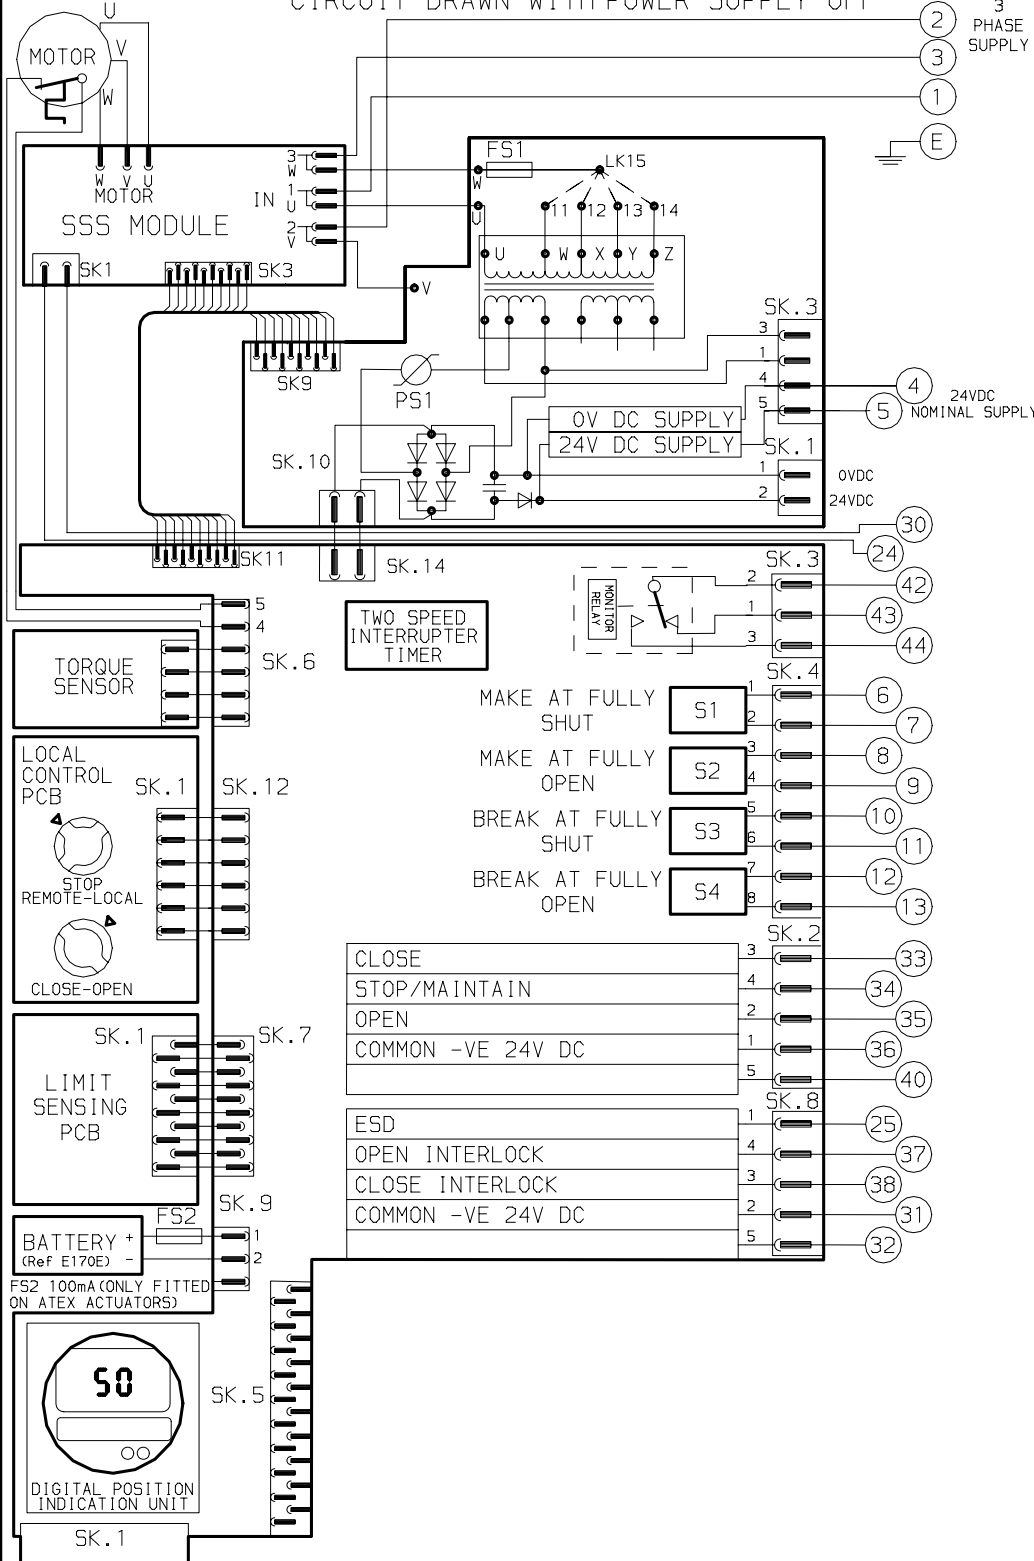

FOR TYPICAL REMOTE CONTROL DETAILS SEE DOCUMENT RWS500

TRANSFORMER TAPPING OPTIONS

TYPE 1

TAP	NOM 50/60HZ	50HZ	60HZ
W	220/230	176-242	198-259
X	380/400	304-418	342-446
Y	415/420	332-457	374-487
Z	440/460	352-484	396-517

FUSE FS1 - 250mA ANTI-SURGE

TYPE 2

TAP	NOM 50/60HZ	50HZ	60HZ
W	346/380	285-388	321-419
X	480/500	406-552	432-564
Y	240/240	192-261	216-282
Z	550/575	445-605	501-625

FUSE FS1 - 250mA ANTI-SURGE

THE ACTUATOR MUST BE PROTECTED USING SUITABLY RATED HIGH SPEED SEMI-CONDUCTOR FUSES ON THE INCOMING SUPPLY.

SUGGESTED FUSES:-  
 IQ10-20:10 Amp Ferraz G330010  
 IQ25-35:20 Amp Ferraz K330013  
 or EQUIVALENT PROTECTIVE DEVICE.  
 ALL TRANSFORMER TYPES - PS1 SELF  
 RESETTING  
 FUSE

NOTE

REFER TO PUBLICATION E170E FOR APPROVED FUSES FS1 AND FS2.

MAX EXTERNAL LOAD ON TERMINALS 4 & 5 TO BE 5W.

CONTROL SIGNAL THRESHOLD VOLTAGES TO BE MINIMUM 'ON' 20V AC/DC  
 MAXIMUM 'OFF' = 3V  
 MINIMUM CONTROL SIGNAL DURATION TO BE 100mS.

CURRENT DRAWN FROM EACH REMOTE CONTROL SIGNAL IS 5mA ON 24V DC

WIRES ARE IDENTIFIED AT EACH END BY TERMINAL No. OR TAG No.

INDICATION CONTACTS S1-S4 ARE SHOWN IN THEIR DEFAULT CONFIGURATION. CONTACTS MAY BE CONFIGURED FOR ANY OF THE FUNCTIONS DESCRIBED IN E170E

No	DATE	REVISION DETAILS
02	250210 PJW	SSS UPDATED TO CELDUC. Checked: JCI EC2680/1

**www.rotork.com**

ROTORK CONTROLS LTD BATH, BA1 3JQ ENGLAND Tel:01225-733200	ROTORK CONTROLS INC ROCHESTER NY 14624, USA Tel:585-328-1550
---	---

CONFIG BY PJW  
 DATE 250707  
 CHECKED DA  
 BASE WD --  
 JOB No --  
 M.I.No .

**IQM & TWO SPEED TIMER**

CIRCUIT DIAGRAM No -REV 102  
**5000-010-02**

B1 C1 B2 C2