


CIRCUIT DRAWN WITH
POWER SUPPLY OFF

THREE
PHASE
SUPPLY

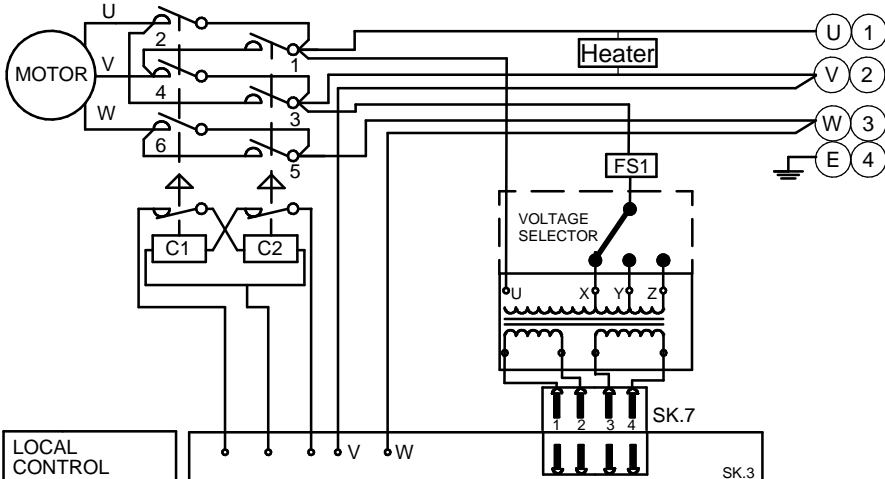

TRANSFORMER TAPPING

TAP	NOM 50/60HZ	50HZ	60HZ
X	220/230	176-242	198-259
Y	380/400	304-418	342-446
Z	440/460	352-484	396-517

FS1 - See Rompak PUB008-006 Installation and Maintenance Manual

NOTE

FOR TYPICAL REMOTE CONTROL INDICATING, MONITORING AND ALARM CIRCUITS SEE PUBLICATION DOC862

MAX EXTERNAL LOAD ON SIR RELAYS TO BE 5A. MAX VOLTAGE 120V AC/DC

MAX EXTERNAL LOAD ON TERMINAL 27 & 28 TO BE 3W

CONTROL SIGNAL THRESHOLD VOLTAGES:

TO BE MINIMUM 'ON' 14V DC AT 1mA
MAXIMUM 'OFF' = 3V
MINIMUM CONTROL SIGNAL DURATION TO BE 300mS.

CURRENT DRAWN FROM EACH REMOTE CONTROL SIGNAL IS 5mA ON 24V DC

CUSTOMER LIMIT CONNECTIONS
MAXIMUM CURRENT 3A MAXIMUM VOLTAGE 120V AC/DC


FOR CLOCKWISE TO CLOSE
S1 OPEN BECOMES S1 OPEN

FOR CLOCKWISE TO CLOSE
S2 CLOSE BECOMES S2 CLOSE

ACTUATOR CONFIGURATION
VIA DIL SWITCH SW2

REFER TO INSTALLATION INSTRUCTIONS FOR DIL SWITCH SELECTION

NOT USED

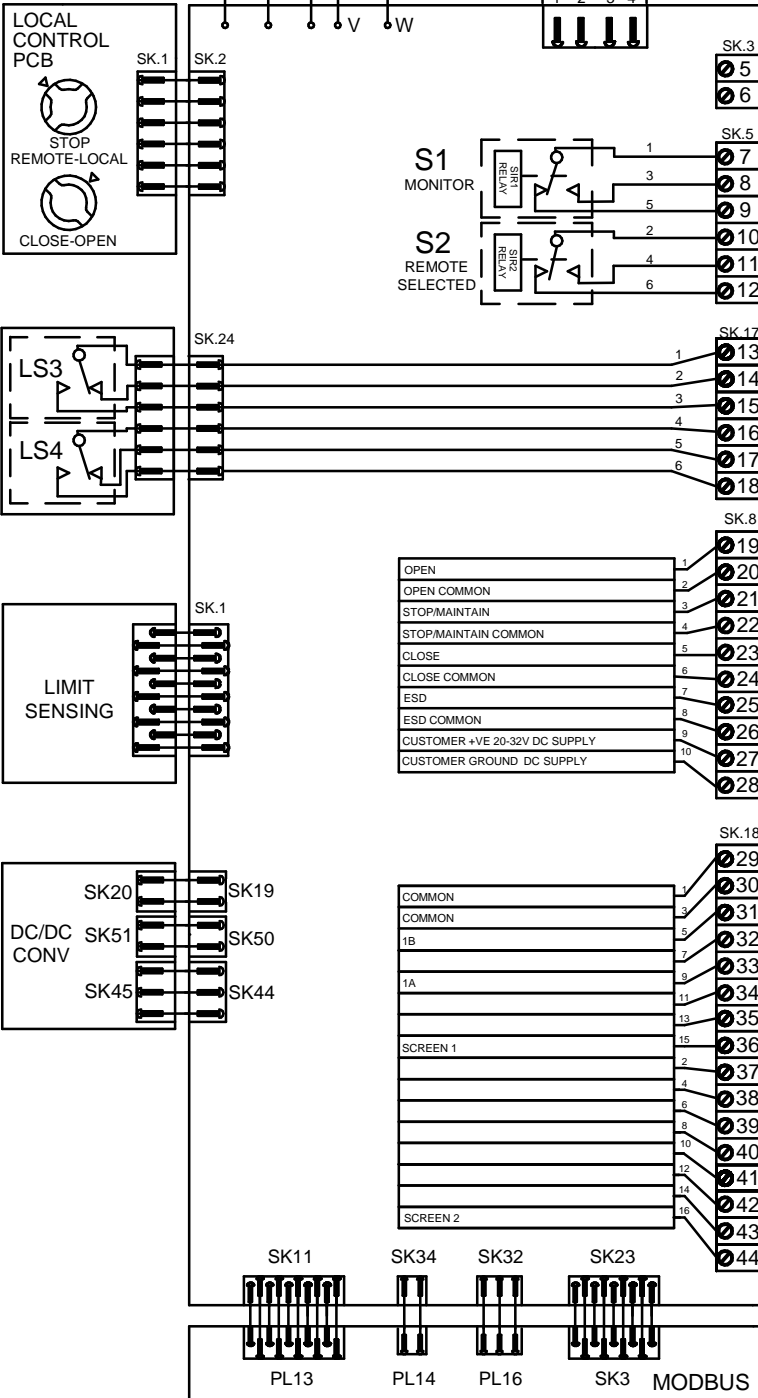

Iss	Date	Chkd	Revision Details
1	150414		First Issue.

www.rotork.com

ROTORK CONTROLS LTD
BATH, BA1 3JQ
ENGLAND
Tel:01225-733200

ROTORK CONTROLS INC
ROCHESTER
NY 14624, USA
Tel:585-247-2304

ROMPAK 3PH - NO TORQUE
SWITCHES+MODBUS

Drawn by: VYA
Date : 15-Apr-14
Base WD: R200-400
Job No : - -
MI No : - -

Circuit Diagram No
R200-400
Issue No
1