

CIRCUIT DRAWN WITH
POWER SUPPLY OFF

FOR TYPICAL REMOTE CONTROL
DETAILS SEE DOCUMENT
RWS302

TRANSFORMER TAPPING OPTIONS

TAP	NOM 50/60HZ	50HZ	60HZ
W	200	160-220	180-236
X	220	176-242	198-259
Y	400	320-440	360-472
Z	440	352-484	396-519

FUSE FS1 - 250mA ANTI-SURGE

NOTE


REFER TO PUBLICATION E170E FOR
APPROVED FUSES FS1 AND FS2.

MAX EXTERNAL LOAD ON TERMINALS
4 & 5 TO BE 5W.

CONTROL SIGNAL THRESHOLD VOLTAGES
TO BE MINIMUM 'ON' 20V AC/DC
MAXIMUM 'OFF' = 3V
MINIMUM CONTROL SIGNAL DURATION
TO BE 300mS.

CURRENT DRAWN FROM EACH REMOTE
CONTROL SIGNAL IS 5mA ON 24V DC
OR 12mA ON 120V AC

WIRES ARE IDENTIFIED AT EACH END
BY TERMINAL No. OR TAG No.

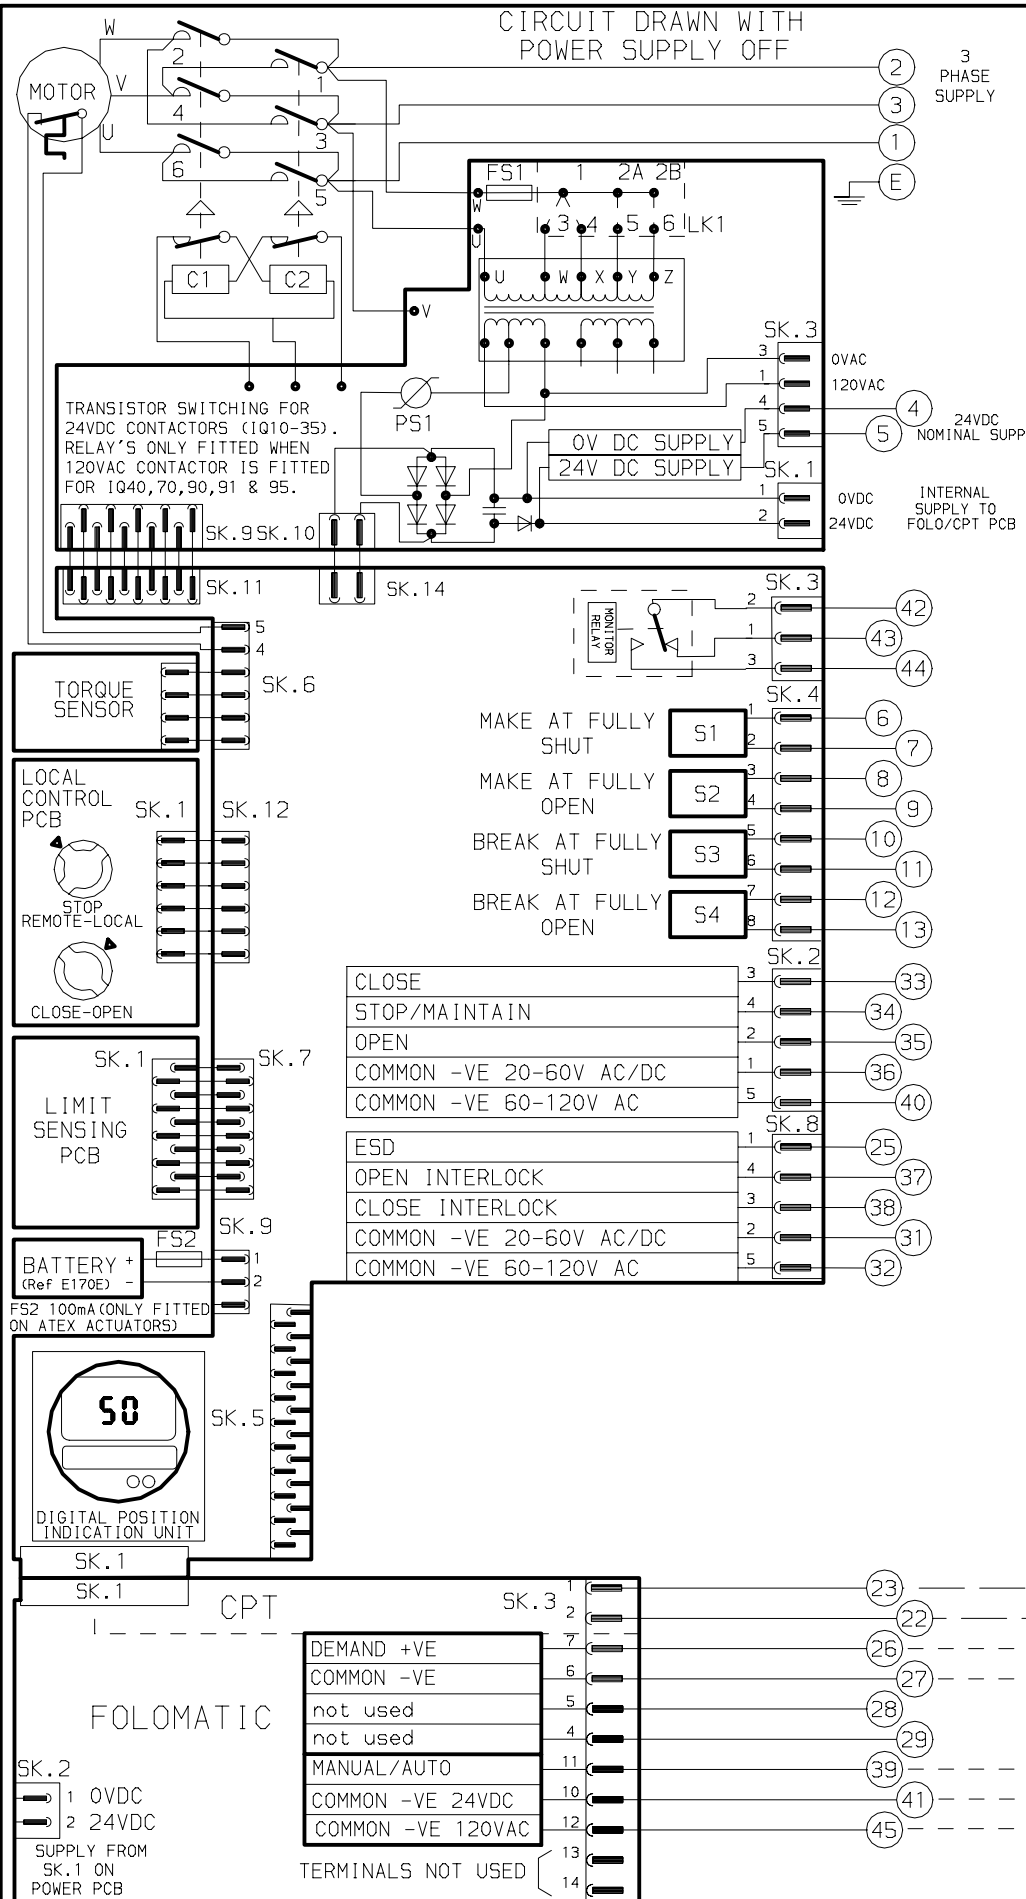

No	DATE	REVISION DETAILS
04	110407	IQ PRO UPDATE. EC2198/1

www.rotork.com

ROTORK CONTROLS LTD
BATH, BA1 3JQ
ENGLAND
Tel: 01225-733200

ROTORK CONTROLS INC
ROCHESTER
NY 14624, USA
Tel: 585-328-1550

CONFIG BY PRE
DATE 081004
CHECKED PJW
BASE WD 4010-100
JOB No JZ0395
M.I.No .

IQ JAPAN TRANSFORMER
+ FOLOMATIC + CPT

CIRCUIT DIAGRAM No -REV 102
4010-100-04
B1 C1 B2 C2