


CIRCUIT DRAWN WITH  
POWER SUPPLY OFF

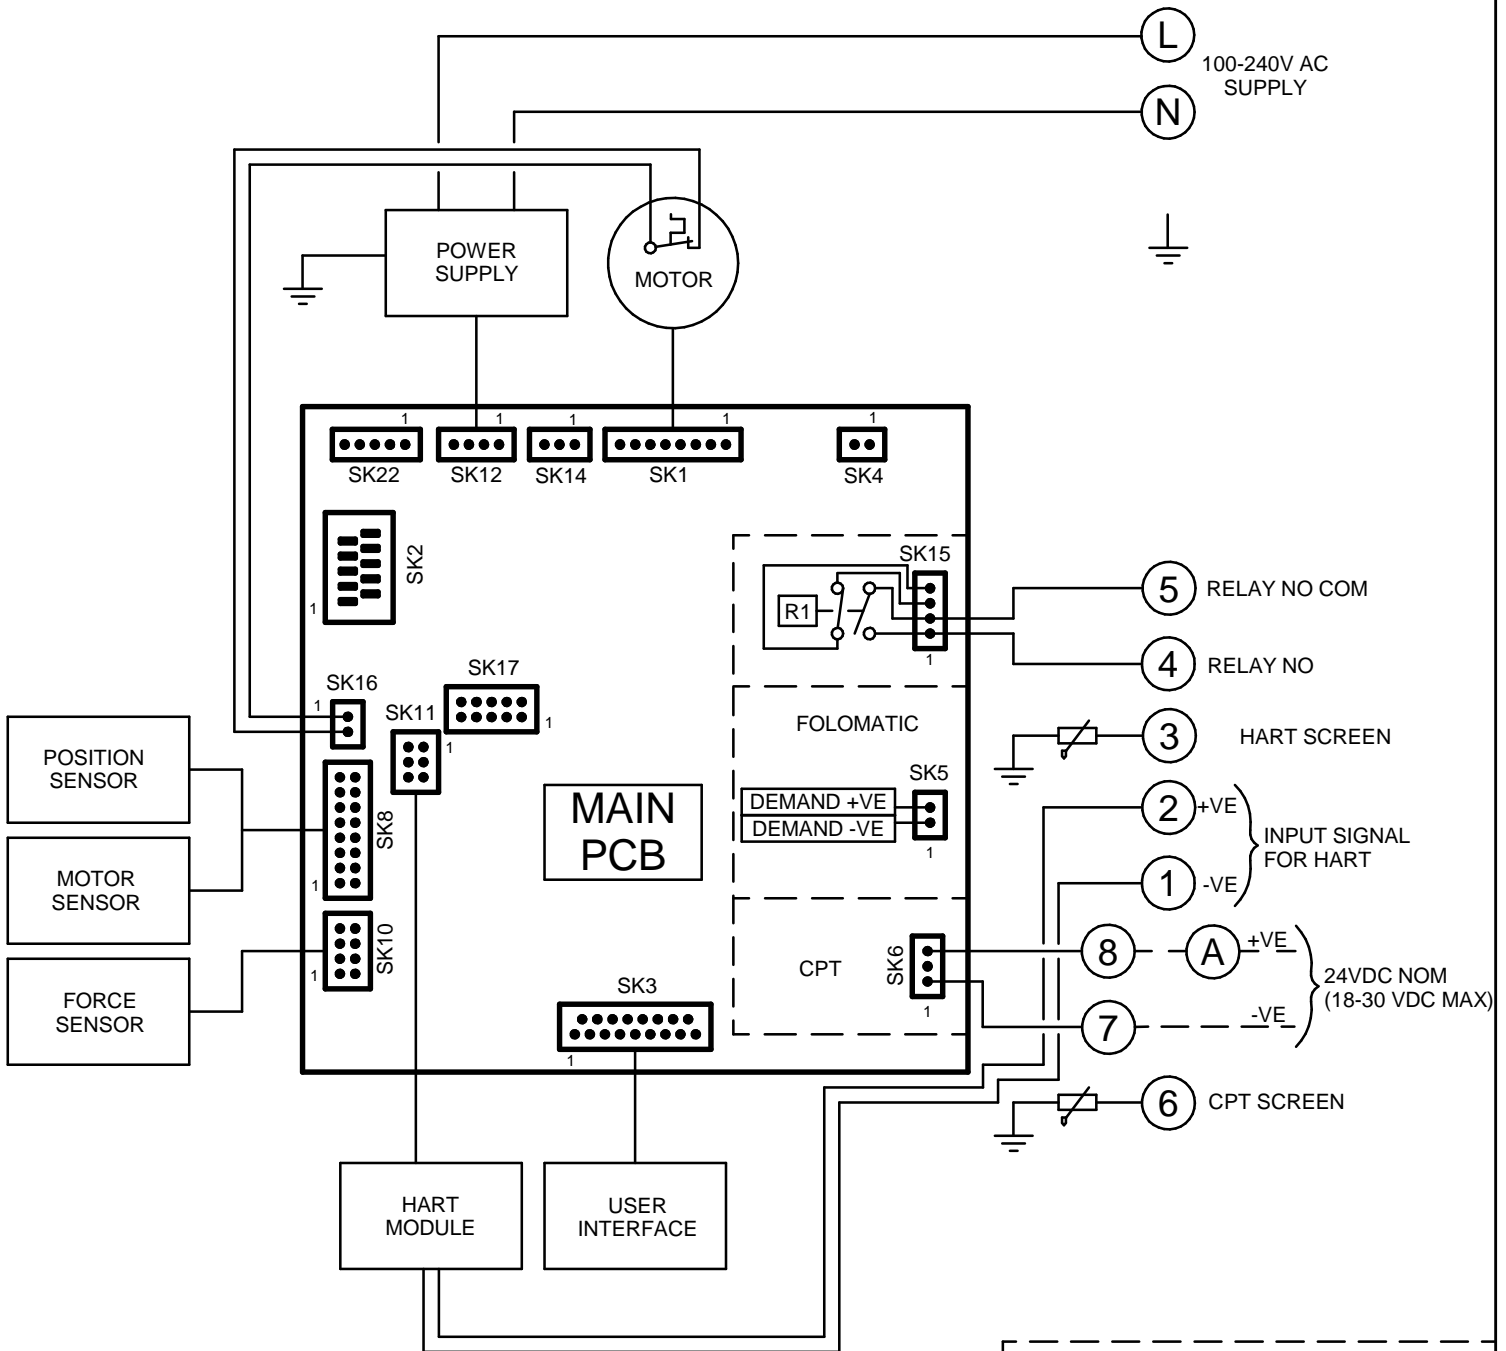

RELAY R1 CAN BE CONFIGURED TO INDICATE ANY ONE OF THE FOLLOWING:-

- 0 DISABLED
- 1 REMOTE CONTROL AVAILABLE
- 2 FAULT
- 3 FULLY OPEN
- 4 FULLY CLOSED
- 5 FORCE TRIP OPENING
- 6 FORCE TRIP CLOSING
- 7 FORCE TRIP ANY POSITION
- 8 FAILSAFE OPERATION

UPS SOCKET FOR  
CVL5000 / CVQ6000



CVL1000/1500/5000/  
CVQ2400/6000  
RESISTOR PACK  
FITTED TO SK4 IF NO  
SOLINOID FITTED.



WHEN MANUAL  
OVERRIDE IS FITTED  
MOTOR DISABLE  
SWITCH FITTED IN  
SERIES WITH  
THERMOSTAT (SK16)

Iss	Date	Chkd	Revision Details
5	160312 PMJ	PJW	NOTES ADDED + SK22.
4	130710 PJW	JC1	Hart connection detail corrected.
3	131109 BJS	AGM	Voltage source added for CPT.

[www.rotork.com](http://www.rotork.com)

ROTORK CONTROLS LTD  
BATH, BA1 3JQ  
ENGLAND  
Tel:01225-733200

ROTORK CONTROLS INC  
ROCHESTER  
NY 14624, USA  
Tel:585-247-2304

CVA, A/C SUPPLY, N/O CONTACT,  
HART INTERFACE

Drawn by: D.Adams  
Date : 081008  
Base WD: C00-10  
Job No : --  
MI No : --

Circuit Diagram No

**C00-10**

Issue  
No  
**5**