


CIRCUIT DRAWN WITH
POWER SUPPLY OFF

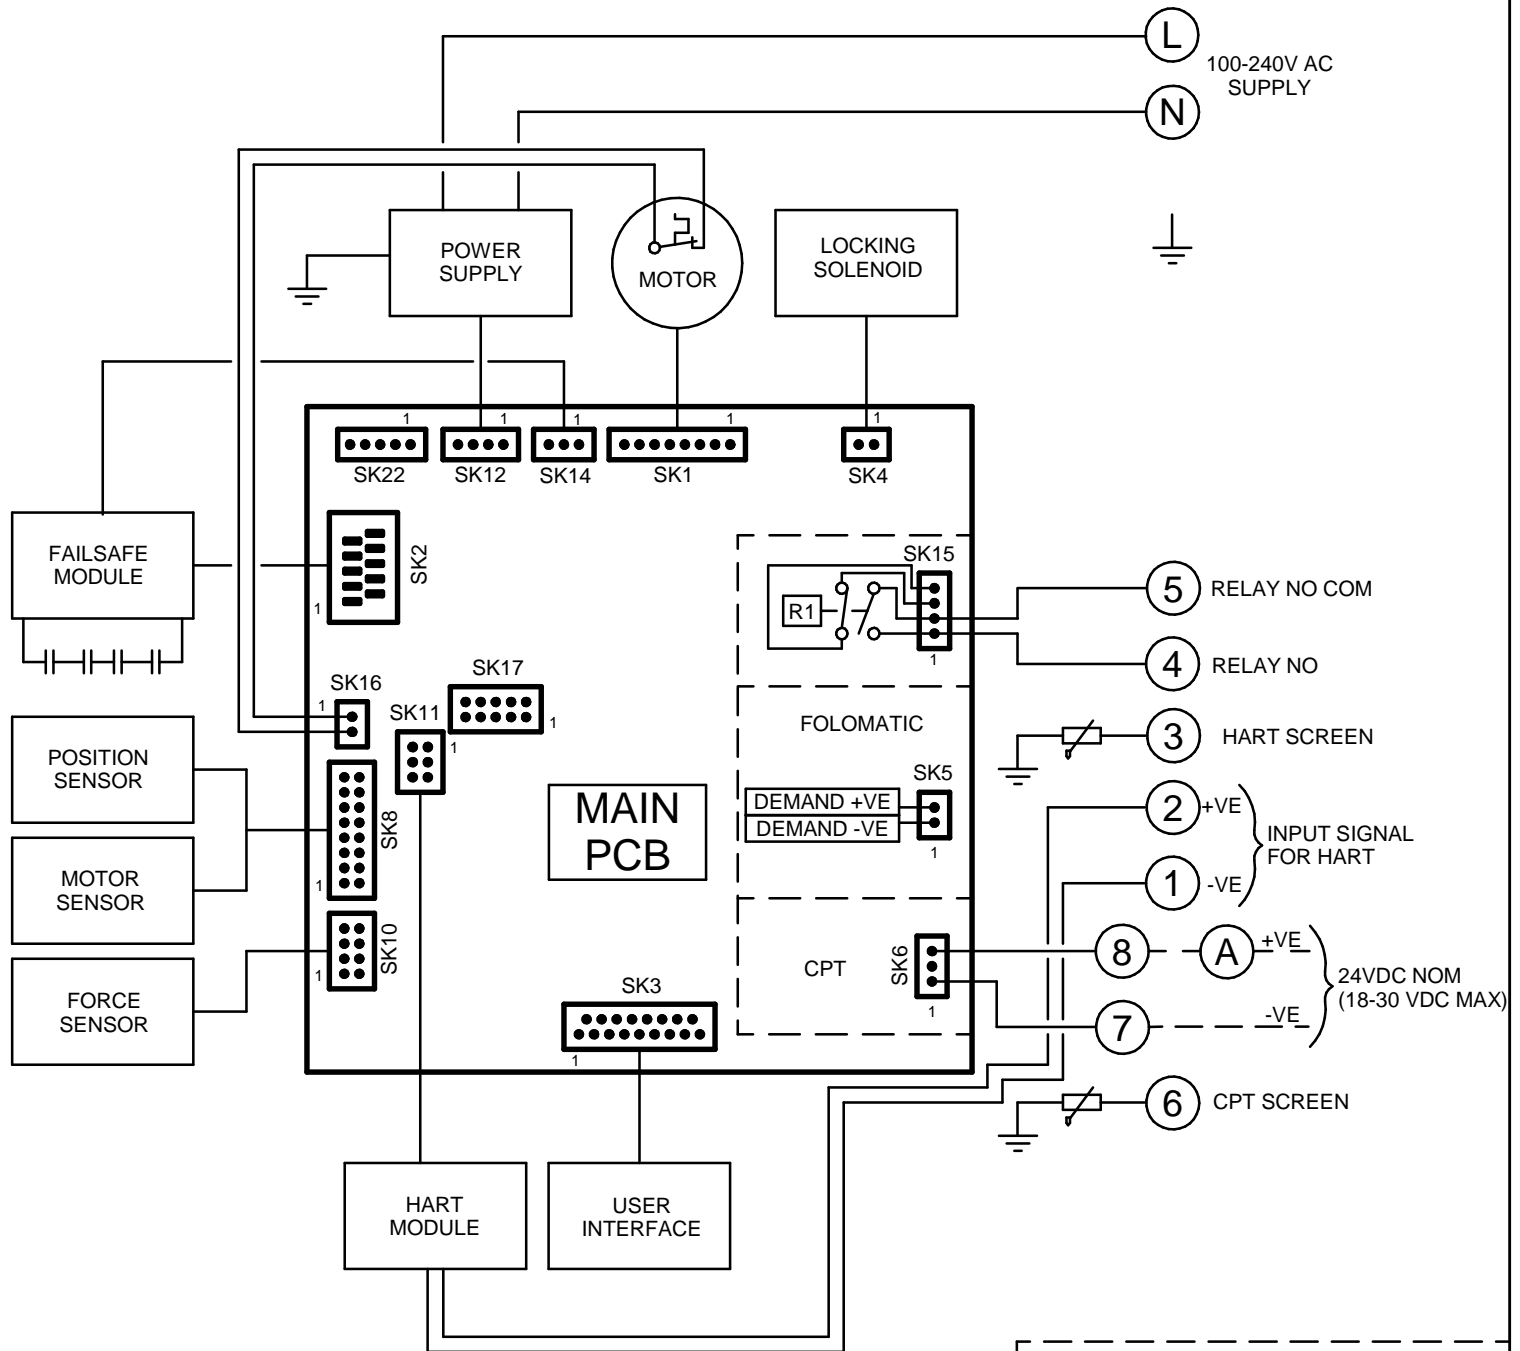

RELAY R1 CAN BE CONFIGURED TO INDICATE ANY ONE OF THE FOLLOWING:-

- 0 DISABLED
- 1 REMOTE CONTROL AVAILABLE
- 2 FAULT
- 3 FULLY OPEN
- 4 FULLY CLOSED
- 5 FORCE TRIP OPENING
- 6 FORCE TRIP CLOSING
- 7 FORCE TRIP ANY POSITION
- 8 FAILSAFE OPERATION

UPS SOCKET FOR
CVL5000 / CVQ6000



WHEN MANUAL
OVERRIDE IS FITTED
MOTOR DISABLE
SWITCH FITTED IN
SERIES WITH
THERMOSTAT (SK16)

Iss	Date	Chkd	Revision Details
5	020712 PJW	JC1	HART CONNECTION DETAIL CORRECTED.

www.rotork.com

ROTORK CONTROLS LTD
BATH, BA1 3JQ
ENGLAND
Tel:01225-733200

ROTORK CONTROLS INC
ROCHESTER
NY 14624, USA
Tel:585-247-2304

CVA, A/C SUPPLY, LOCK SOL + MOR,
N/O CONTACT, HART & FAILSAFE.

Drawn by: D.Adams
Date : 081008
Base WD: C22-10
Job No : - -
MI No : - -

Circuit Diagram No
C22-10
Issue No
5