

CIRCUIT IS DRAWN FOR A VALVE IN THE FULLY CLOSED POSITION

Circuit Diagram No - Issue No

6P06Q70 - 01

TRANSFORMER TAPPING OPTIONS

TAP	NOM50/60HZ	50HZ	60HZ
X	380/440	342-418	396-484
Y	400/460	360-440	414-506
Z	415/480	373-457	432-528

JUMPER AT LK2 FOR TAPPING X

JUMPER AT LK3 FOR TAPPING Y

JUMPER AT LK4 FOR TAPPING Z

OT/LS - OPEN TORQUE/LIMIT SWITCH.

CT/LS - CLOSE TORQUE/LIMIT SWITCH.

OAS - OPEN AUXILIARY SWITCH.

CAS - CLOSE AUXILIARY SWITCH.

IAS1 & 2 - INTERMEDIATE AUXILIARY SWITCHES ADJUSTABLE TO MAKE OR BREAK INDIVIDUALLY AT ANY POSITION.

WIRES ARE IDENTIFIED AT EACH END BY TERMINAL NUMBER OR NUMBER SHOWN.

FS1 - 100 mA


FS2 - 1 A

FS3 - 250 mA

TERMINALS 4 & 5 FUSED INTERNALLY AT 160mA

ANALOGUE INPUTS (FOR DETAILS, SEE ROTORK PUBLICATION PUB007-008-00

MANUAL/AUTO.

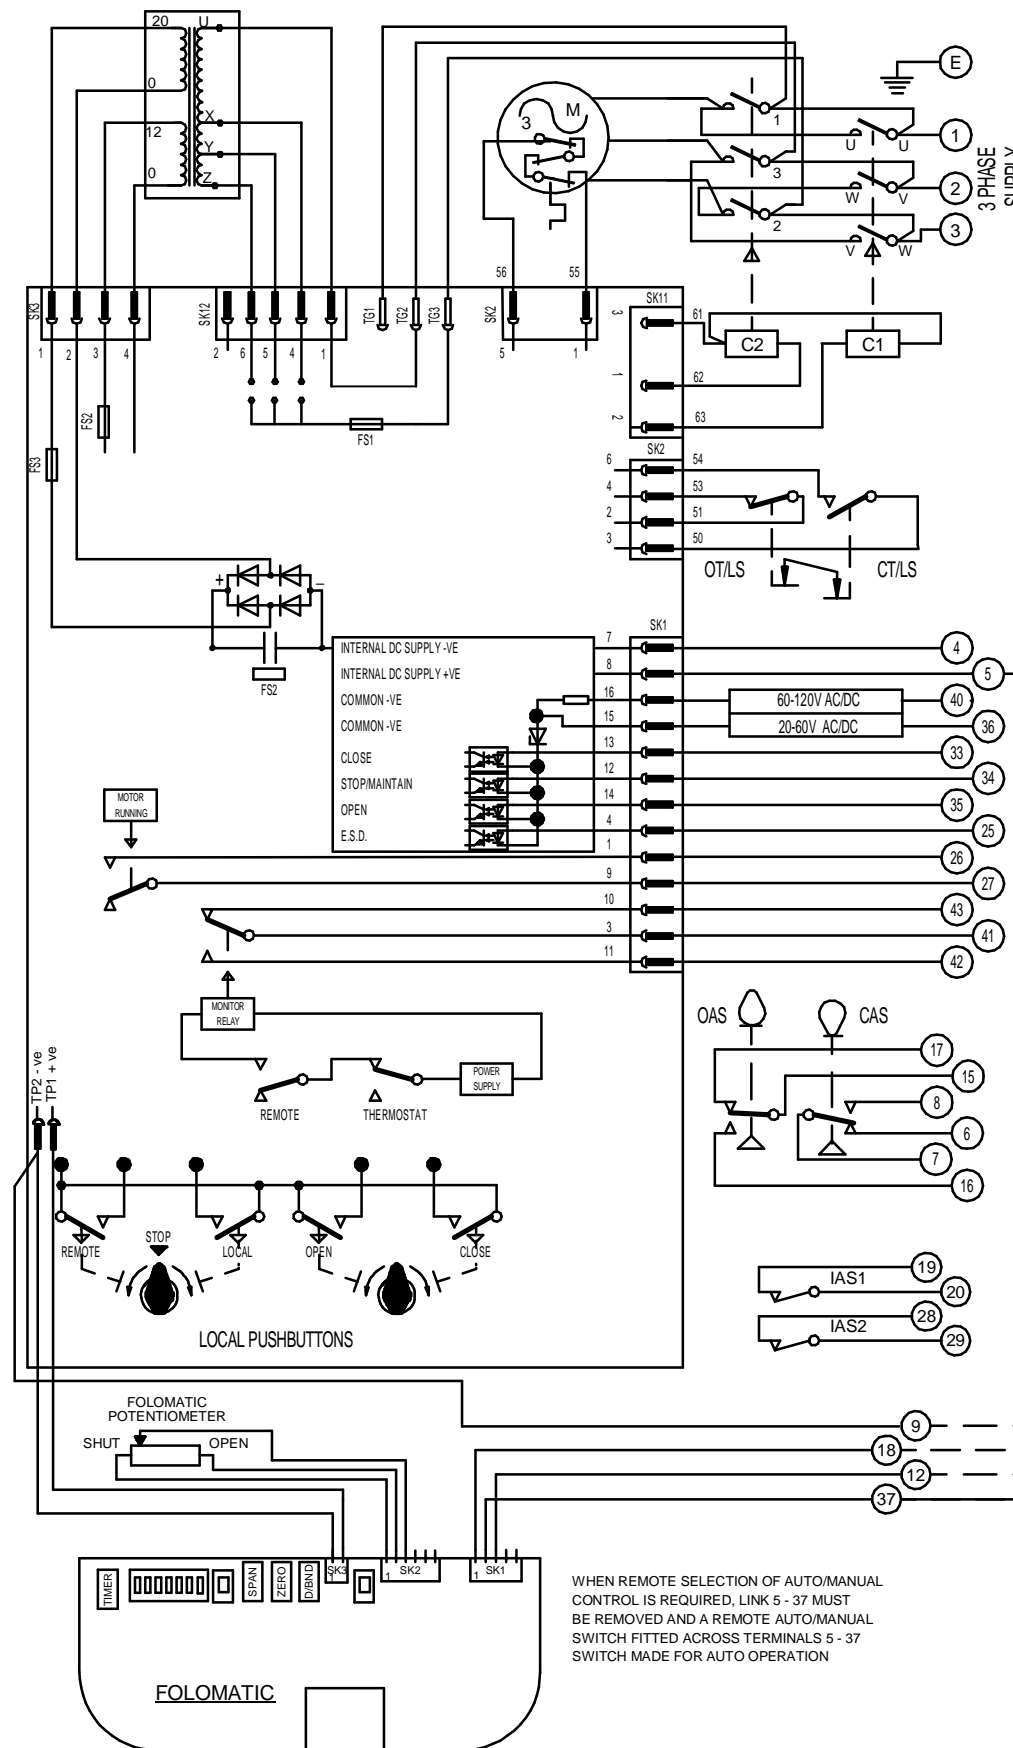

WHEN REMOTE SELECTION OF AUTO/MANUAL CONTROL IS REQUIRED, LINK 5 - 37 MUST BE REMOVED AND A REMOTE AUTO/MANUAL SWITCH FITTED ACROSS TERMINALS 5 - 37 SWITCH MADE FOR AUTO OPERATION

Iss	Date	Chkd	Revision Details
01	161118	JS	FIRST ISSUE

www.rotork.com
 ROTORK CONTROLS (INDIA) PRIVATE LTD
 28B, AMBATTUR INDUSTRIAL ESTATE (NORTH),
 AMBATTUR, CHENNAI - 600 098 INDIA.
 Tel:044-39555600

Q-PAK. + POT. + INTERMEDIATE SWITCH + FOLOMATIC	
Drawn by: JS Date : 161118 Base WD: Job No : - MI No : .	Circuit Diagram No Issue No 6P06Q70 1