


CIRCUIT DRAWN WITH  
POWER SUPPLY OFF

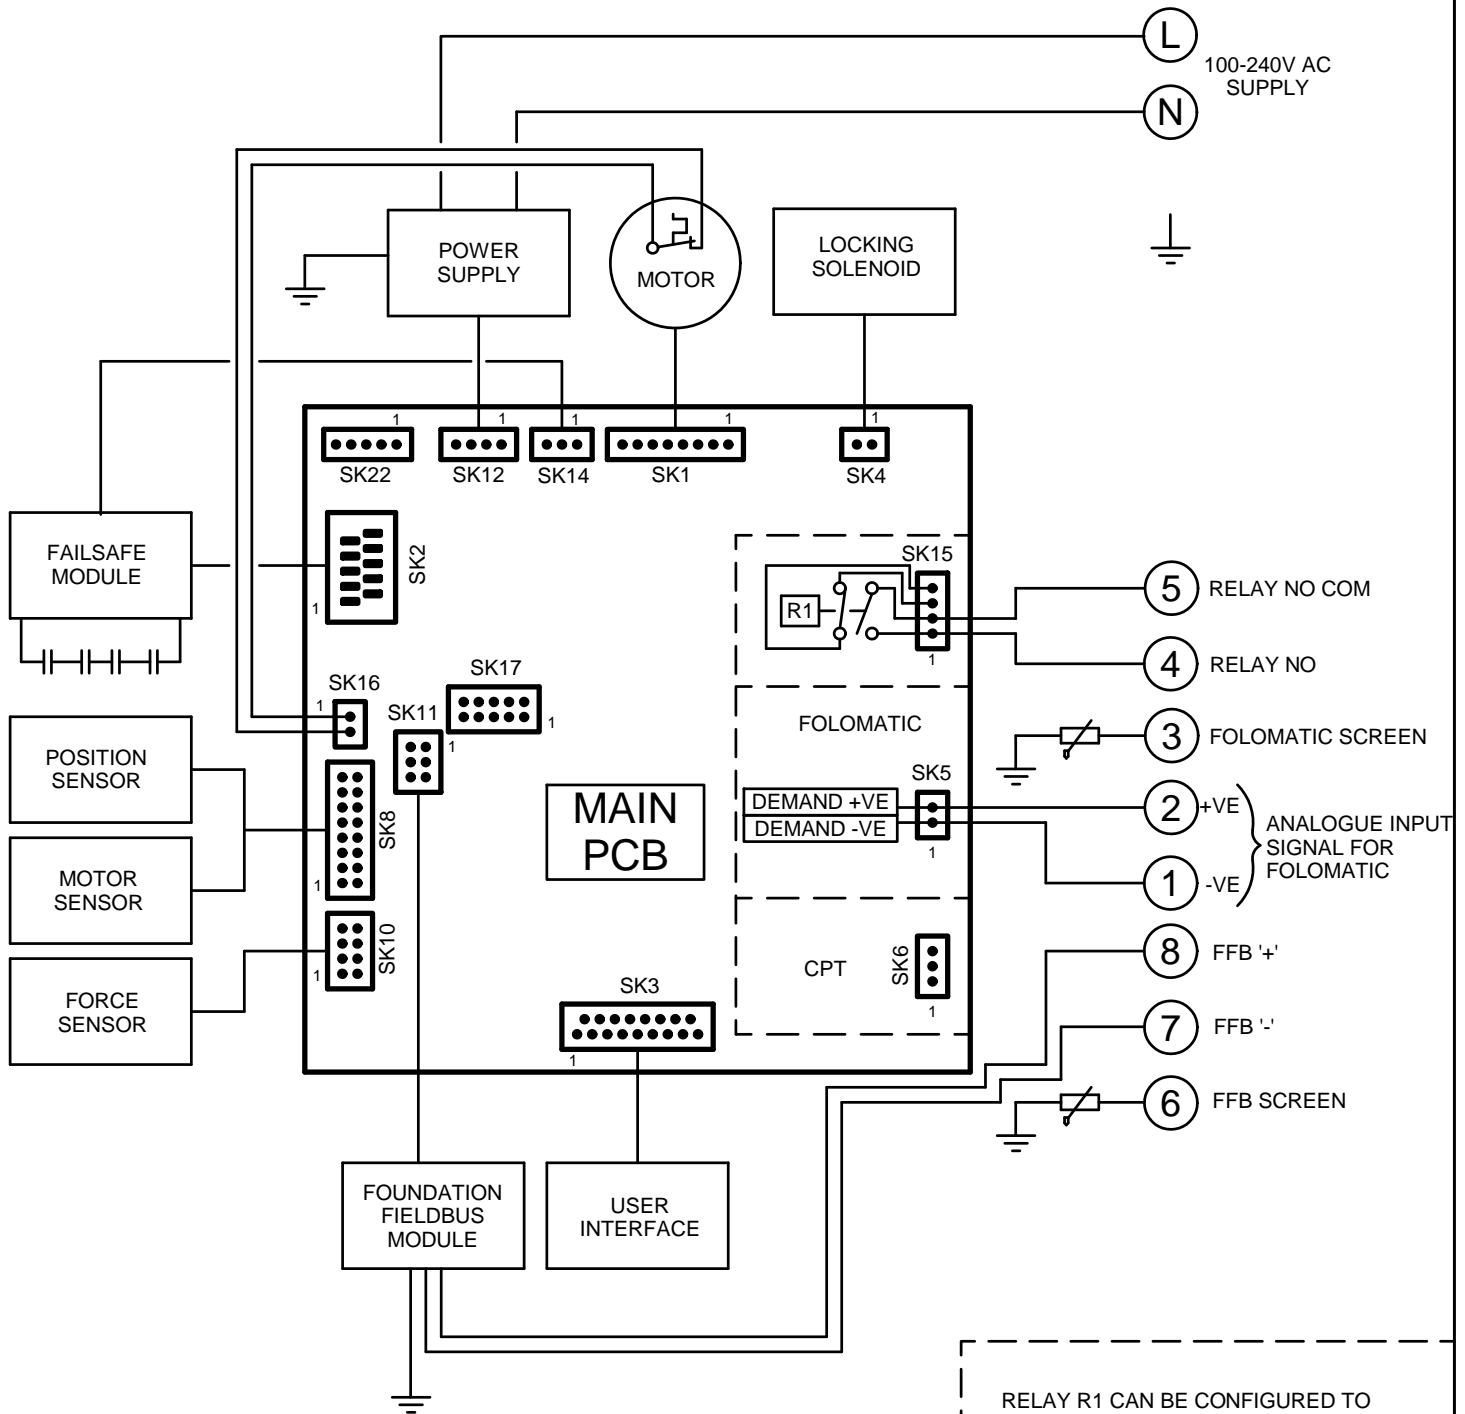

RELAY R1 CAN BE CONFIGURED TO INDICATE ANY ONE OF THE FOLLOWING:-

- 0 DISABLED
- 1 REMOTE CONTROL AVAILABLE
- 2 FAULT
- 3 FULLY OPEN
- 4 FULLY CLOSED
- 5 FORCE TRIP OPENING
- 6 FORCE TRIP CLOSING
- 7 FORCE TRIP ANY POSITION
- 8 FAILSAFE OPERATION

UPS SOCKET FOR  
CVL5000 / CVQ6000



WHEN MANUAL  
OVERRIDE IS FITTED  
MOTOR DISABLE  
SWITCH FITTED IN  
SERIES WITH  
THERMOSTAT (SK16)

Iss	Date	Chkd	Revision Details
2	190312 PMJ	PJW	NOTES ADDED + SK22.
1	210211 PMJ	JC1	First Issue.

[www.rotork.com](http://www.rotork.com)

ROTORK CONTROLS LTD  
BATH, BA1 3JQ  
ENGLAND  
Tel:01225-733200

ROTORK CONTROLS INC  
ROCHESTER  
NY 14624, USA  
Tel:585-247-2304

CVA, A/C SUPPLY, N/O CONTACT,  
F-FBUS, LOCK SOL,+ MOR & F-SAFE

Drawn by: PJW  
Date : 210211  
Base WD: C22-80  
Job No : --  
MI No : --

Circuit Diagram No  
**C22-80**  
Issue No  
**2**