


CIRCUIT DRAWN WITH
POWER SUPPLY OFF

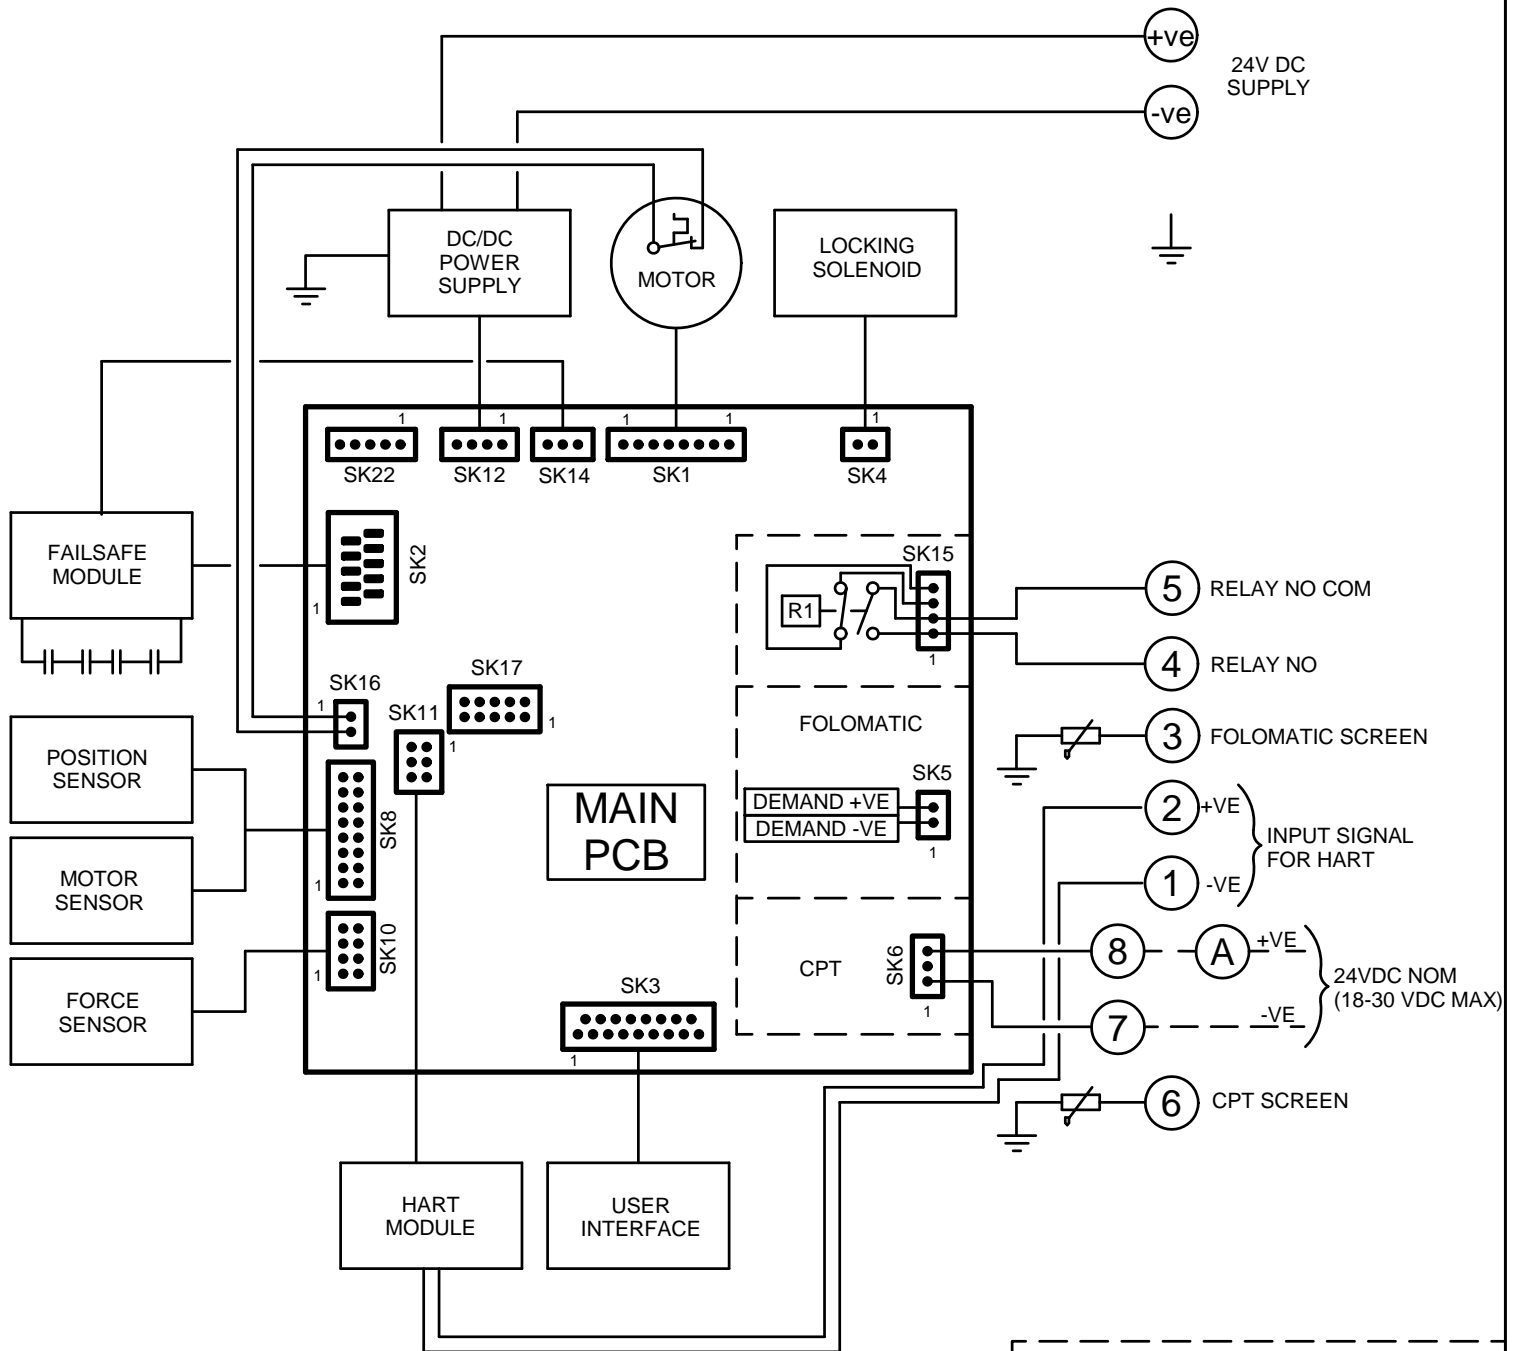

RELAY R1 CAN BE CONFIGURED TO INDICATE ANY ONE OF THE FOLLOWING:-

- 0 DISABLED
- 1 REMOTE CONTROL AVAILABLE
- 2 FAULT
- 3 FULLY OPEN
- 4 FULLY CLOSED
- 5 FORCE TRIP OPENING
- 6 FORCE TRIP CLOSING
- 7 FORCE TRIP ANY POSITION
- 8 FAILSAFE OPERATION

UPS SOCKET FOR
CVL5000 / CVQ6000



WHEN MANUAL
OVERRIDE IS FITTED
MOTOR DISABLE
SWITCH FITTED IN
SERIES WITH
THERMOSTAT (SK16)

Iss	Date	Chkd	Revision Details
2	190312 PMJ	PJW	NOTES ADDED + SK22.
1	010111 PMJ	PMJ	First Issue.

www.rotork.com

ROTORK CONTROLS LTD
BATH, BA1 3JQ
ENGLAND
Tel:01225-733200

ROTORK CONTROLS INC
ROCHESTER
NY 14624, USA
Tel:585-247-2304

CVA, D/C SUPPLY, N/O CONTACT,
LOCK SOL + MOR F-SAFE & HART.

Drawn by: P.Johns
Date : 070111
Base WD: C32-10
Job No : --
MI No : --

Circuit Diagram No
C32-10

Issue
No
2