

CIRCUIT DRAWN WITH  
POWER SUPPLY OFF

FOR TYPICAL REMOTE CONTROL  
DETAILS SEE DOCUMENT  
**RWS300**

TRANSFORMER TAPPING OPTIONS



TYPE 1 TYPE 2

TAP	NOM	RANGE	TAP	NOM	RANGE
X	100	80-120	X	200	160-240
Y	110	88-132	Y	230	184-276
Z	120	96-144	Z	270	216-324
FS1-250mA A/S FS2-5A A/S			FS1-150mA A/S FS2-2.5A A/S		

TYPE 3 TYPE 4

TAP	NOM	RANGE	TAP	NOM	RANGE
X	380	304-456	X	480	384-576
Y	400	320-480	Y	575	460-690
Z	415	332-498	Z	690	552-828
FS1-100mA A/S FS2-1.5A A/S			FS1-50mA A/S FS2-1.6A F/A		

ALL TRANSFORMER TYPES -  
FUSE FS3 - 20A ATO FAST ACTING  
PS1 SELF RESETTING FUSE

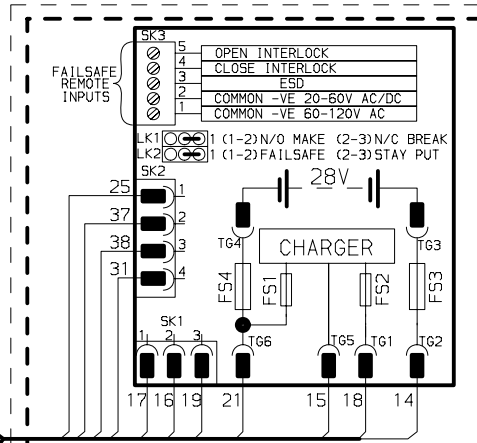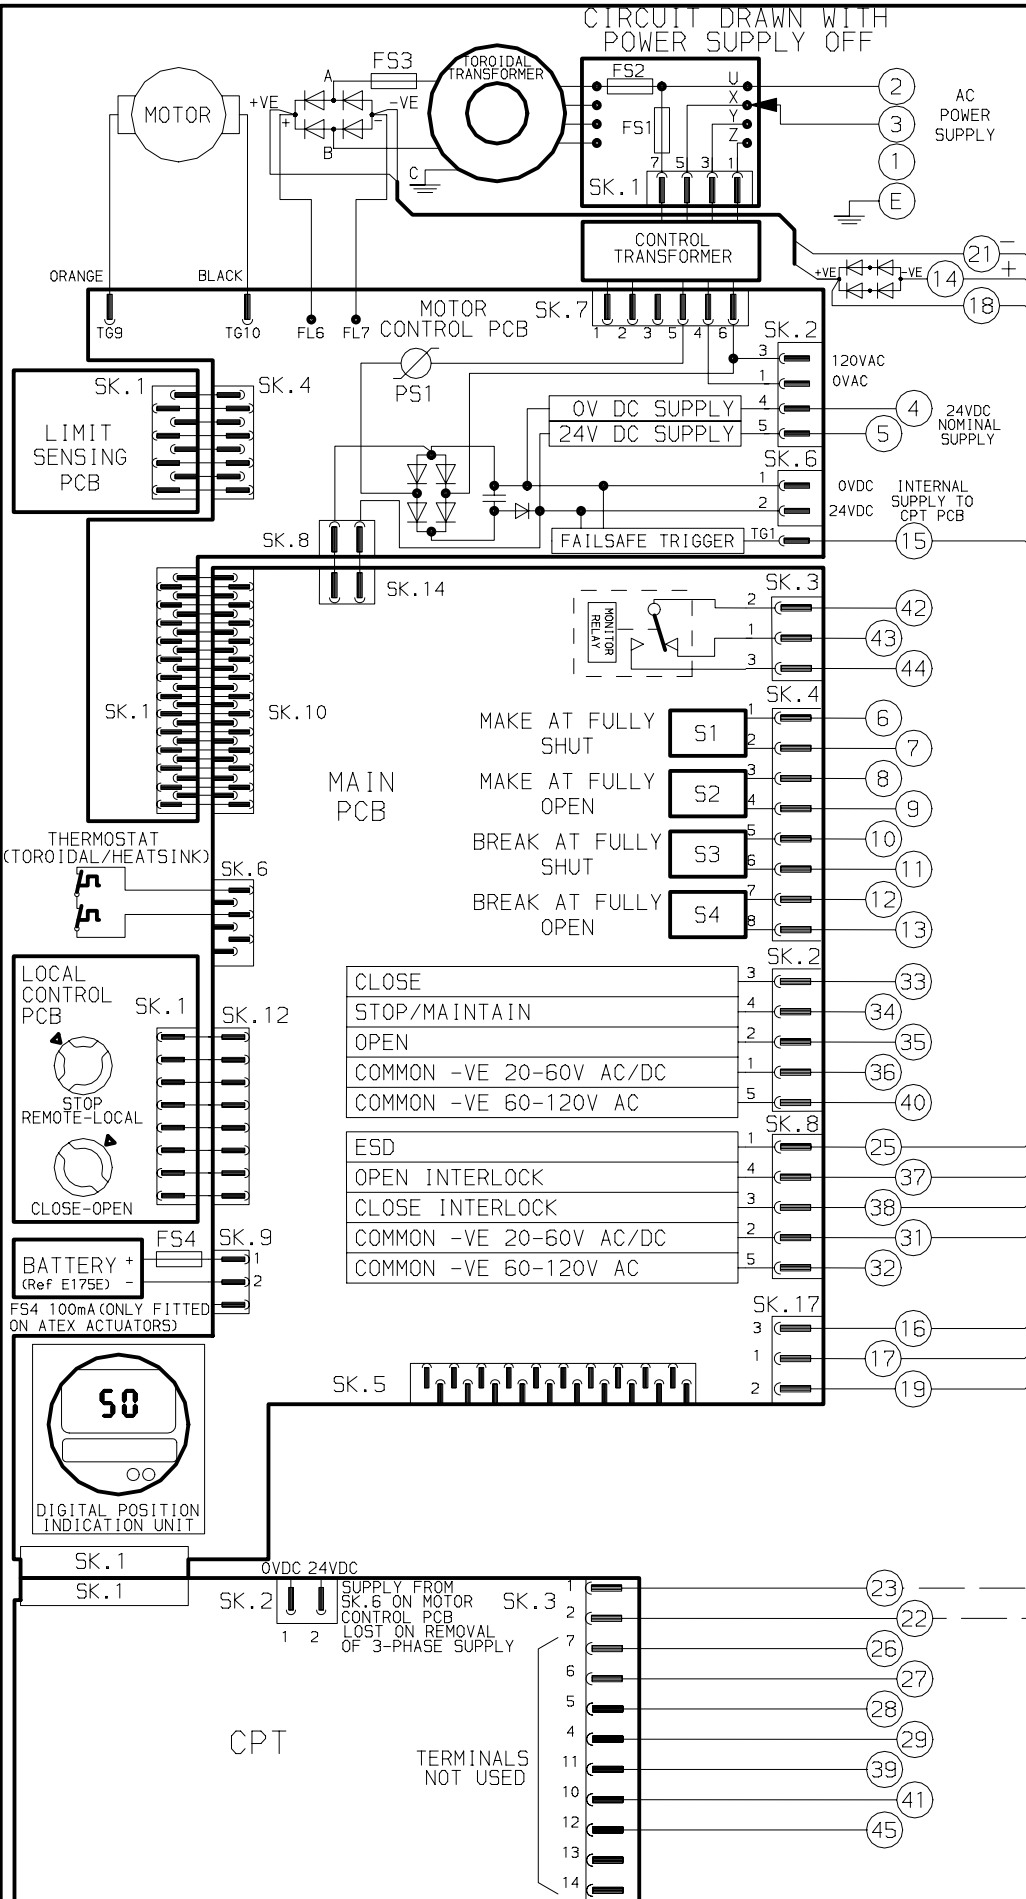

**BATTERY PACK**

FOR DETAILS SEE PUBLICATION E120E  
FS3, FS4 - 20A ATO FAST ACTING  
FS1, FS2 - 2A 20mm QUICK BLOW  
FAILSAFE OPERATION, ON LOSS OF 3-PHASE  
CUSTOMER SUPPLY ON 4 & 5 IS ALSO LOST.  
IF AN INTERNAL SUPPLY IS REQUIRED FOR  
FAILSAFE OPERATION THE 24VDC ON 21 & 14  
MUST BE USED.  
LK1 ESD POLARITY DEFAULT N/O MAKE FOR ESD  
LK2 FAILSAFE OPTION DEFAULT FAILSAFE  
ACTUATOR ESD ACTION(CAT) DEFAULT STAY PUT  
ESD CONTACT(A2) DEFAULT N/O MAKE FOR ESD

**NOTE**  
REFER TO PUBLICATION E175E FOR  
APPROVED FUSES FS1, FS2 AND FS3.  
MAX EXTERNAL LOAD ON TERMINALS  
4 & 5 TO BE 5W.  
WIRES ARE IDENTIFIED AT EACH END  
BY TERMINAL No. OR TAG No.

FOR DETAILS OF CPT FUNCTIONS  
REFER TO ROTORK PUBLICATION E120E  
CONTROL SIGNAL THRESHOLD VOLTAGES  
TO BE MINIMUM 'ON' 20V AC/DC  
MAXIMUM 'OFF' = 3V  
MINIMUM CONTROL SIGNAL DURATION  
TO BE 300ms.  
CURRENT DRAWN FROM EACH REMOTE  
CONTROL SIGNAL IS 5mA ON 24V DC  
OR 12mA ON 120V AC

INDICATION CONTACTS S1-S4 ARE SHOWN  
IN THEIR DEFAULT CONFIGURATION.  
CONTACTS MAY BE CONFIGURED FOR ANY  
OF THE FUNCTIONS DESCRIBED IN E175E

No <b>03</b>	DATE 110407	REVISION DETAILS IQ PRO UPDATE. <b>EC2198/1</b>	<b>www.rotork.com</b>		CONFIG BY D.A.	IQT + CPT + BATTERY PACK
					DATE 140604	
			ROTORK CONTROLS LTD BATH, BA1 3JQ ENGLAND Tel:01225-733200	ROTORK CONTROLS INC ROCHESTER NY 14624, USA Tel:585-328-1550	CHECKED PJW	CIRCUIT DIAGRAM No -REV <b>6019-000-03</b>
					BASE WD 6019-000	
					JOB No -	<b>B1 C1 B2 C2</b>
					M.I.No -	